

PRODUCT IMPROVEMENT BULLETIN



CHRYSLER
AUSTRALIA LTD.

NUMBER: SD 8/72/9

DATE: 26th September, 1972.

SUBJECT :
Headlamp Dip
Switch Protection

Effective on 'H' Series vehicles with build date codes C113 and later, a $\frac{1}{2}$ " length of P.V.C. tube has been added to the dip switch before the front mat or carpet is fitted (Refer attached FIGURE 1).

This prevents the edge of the mat or carpet from being trapped under the edge of the dip switch plunger thereby preventing the full movement of the plunger necessary to actuate the changeover of the switch contacts.

It is recommended that this short length of tube be added to any vehicle which is the subject of owner complaint regarding jamming or inoperative dip switch (Refer Figure 1).

MODEL :
'H' Series

M.G. Aspin

M.G. ASPIN,
MANAGER - SERVICE TECHNICAL OPERATIONS

GROUP :
Electrical

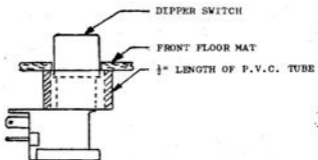


Figure 1.